

Id 42705

Models LA - Discovery 3
LS - Range Rover Sport

Title **Radio** or CD button`s stuck in or broken, Hi Line unit only

Last Modified 04-NOV-2009 17:33

Category Electrical

Symptom 207000 Entertainment Systems

Issue

This is applicable to the Alpine Hi Line 6 CD head unit only

Customer complains that one or more or the **radio**/cd buttons do not operate correctly

Cause

Investigation finds that the button/s are stuck in or broken.

Action

For these symptoms you must replace the front panel which is now available as a separate item and not the complete radio assembly

The procedure to replace the front panel can be found in the following section of the workshop manual for all vehicles up to 10my and is the same

Content for all model years and both models.

Electrical/Information and entertainment systems/Removal and installation/Audio unit fascia.
(415-01)

The repair time that should be quoted for this repair is SRO 86.53.67

PART NUMBERS

**Vin range Disco 3/LR3 000256 to 442164
LR019964(Grey finish)**

**Vin range Disco 3/LR3 442165 to 513325
LR019965(Black finish)**

**Vin range RRSport 900106 to 119896
LR019966(Grey finish)**

**Vin range RRSport 119897 to 215620
LR019967(Black finish)**