

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A VEHICLE TOWED IN - CUST STATES THAT WHILE DRIVING,LOUD RATTLE NOISE OCCURRED,LOW COOLANT LIGHT CAME ON THEN ENGINE LOST POWER. ENGINE TEMP GAUGE DISPLAYING NORMAL TEMP AT DASH.R							
S109	ENGINE						
	27444	CAMPBELL,WALTER LIC#: WALTER					
		CPR 20.00				2420.00	2420.00
1	LR068998	PIPE - FUEL			118.42	75.19	75.19
1	242	USED ENGINE			12500.00	11750.00	11750.00
1	LR073711	PUMP - WATER			202.88	177.96	177.96
1	LR028136	TUBE - OIL COOLE			33.81	22.54	22.54
1	LR030593	SEAL - OIL COOLE			17.55	10.80	10.80
1	LR018275	TUBE - WATER OUT			78.77	55.86	55.86
1	LR077042	MANIFOLD - HEATE			112.88	77.18	77.18
8	LR010881	GASKET - INTAKE			23.89	14.70	117.60
4	WYH500060	NUT			8.65	4.94	19.76

90598

checked out vehicle and found cranking over engine ,it had no signs of compression.fault code check - p0128 - low coolant temp fault code stored prior to fauilure per mileage logged. checked to make sure timing chain and valves were still working. all working correctly. vehicle out of coolant. added water to cooling system to see if it would hold liquid. It does not ,water pours out as fast as put in.removed intake manifold for access to coolant leak. found coolant manifold at front of motor blown open causing a huge coolant leak. all of the coolant leaked out and caused the engine to overheat. It appears that it overheated bad enough to oval the cylinder walls causing no compression. performed a compression test and all 8 cylinders have 0 psi compression performed tear down on engine to verify failed components. cylinders are no longer round and heads warped beyond repair. . engine is beyond repair ,needs new engine assembly, customer authorized ling block assembly. removed engine and replaced with supplied engine.filled with oil, coolant. also topped off front differential as it leaked out when removed for engine. topped off

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.	STATEMENT OF DISCLAIMER The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.	DESCRIPTION	TOTALS
		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)	CUSTOMER SIGNATURE	LESS INSURANCE	
		SALES TAX	
		PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
trans fluid . test drove vehicle several times and vehicle running normal , no codes present. every system working correctly.							

B CAMPAIGN P054 - BRAKE LINE UPDATE							
CAUSE: P054E							
701510			HOSES - FRONT - SET - RENEW				
27444			CAMPBELL,WALTER LIC#: WALTER				
			WPR 0.70				(N/C)
2			LR075628 TUBE - BRAKE				(N/C)
1			GBF401 DOT 4 BRAKE FLD				(N/C)
020202			CONSTANT ALLOWANCE - SEPARATE VEHICLE				
			VISIT TO WORKSHOP				
27444			CAMPBELL,WALTER LIC#: WALTER				
			WPR 0.20				(N/C)
FC: PART#: COUNT:							
CLAIM TYPE: 04							
AUTH CODE:							
P054E*							
90598	p054	completed,	replaced brake lines and bled system.				




C GLASS LIGHTS TIRE INSPECTION.							
GLT GLASS LIGHTS TIRE INSPECTION.							
27444			CAMPBELL,WALTER LIC#: WALTER				
			IPR 0.00				(N/C)
90598	done						

D** EXTENDED WARRANTY CO. PAYING \$10000.00 TOWARDS REPAIR.							
S113 SUBLET							
27444			CAMPBELL,WALTER LIC#: WALTER				
			CPR 0.00			0.00	0.00

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.	STATEMENT OF DISCLAIMER		DESCRIPTION	TOTALS
	The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.		LABOR AMOUNT	
			PARTS AMOUNT	
			GAS, OIL, LUBE	
			SUBLET AMOUNT	
			MISC. CHARGES	
			TOTAL CHARGES	
			LESS INSURANCE	
SALES TAX				
(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)	CUSTOMER SIGNATURE	PLEASE PAY THIS AMOUNT		

CUSTOMER COPY

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
EST: 234.00				31JUL15 09:27	SA: 118		

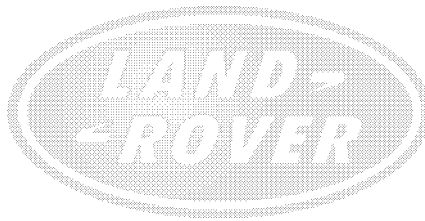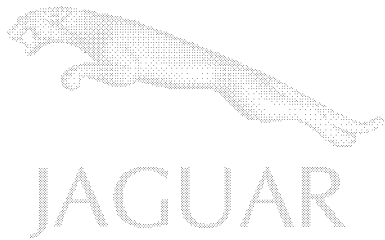

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER

The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOR AMOUNT	2420.00
PARTS AMOUNT	12306.89
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	14726.89
LESS INSURANCE	10000.00
SALES TAX	738.41
PLEASE PAY THIS AMOUNT	5465.30

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

CUSTOMER COPY